

Service Technical Information

| | |
|-----------|---|
| MODEL NO. | NSX-S111 / S112 / S115 / S116 / S119 / S16 A111 / A115 / XR-H220MD |
| SUBJECT | Coming off of KEY, CASS |

REF.No. :G – A0 – 110 – E0


DATE :14. FEB. 2001

<CONTENTS>


KEY, CASS may come off owing to damage on CABI, FR on the above models.
The following countermeasure shall be taken in the event such indication is made.

<COUNTERMEASURE>

- 1) Remove HLDR, CASS and KEY, CASS in the deck area of CABI, FR.
- 2) Cut off the bottom portion of the retention section of KEY, CASS of CABI, FR.
(Total of 14 locations for DECK1 and 2 combined.)

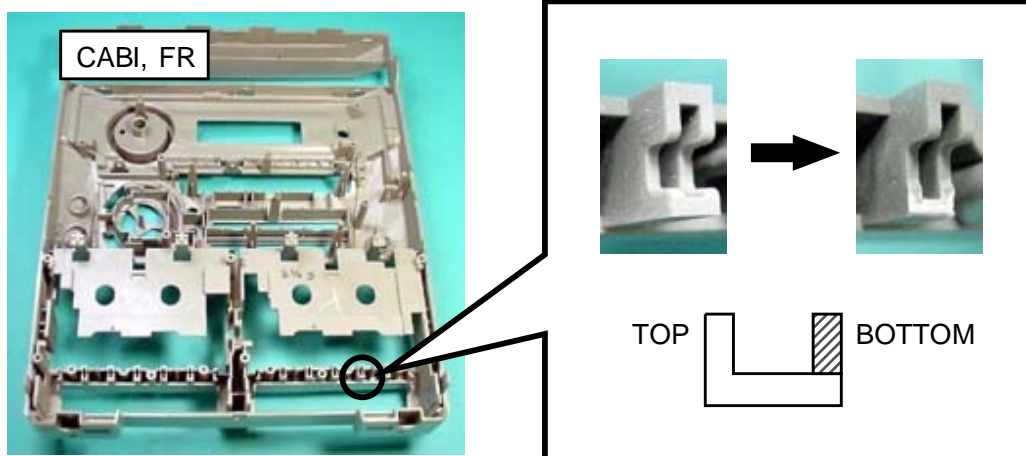

- 3) Install HLDR, CASS of the modified item after installing KEY, CASS and fix it with a screw.

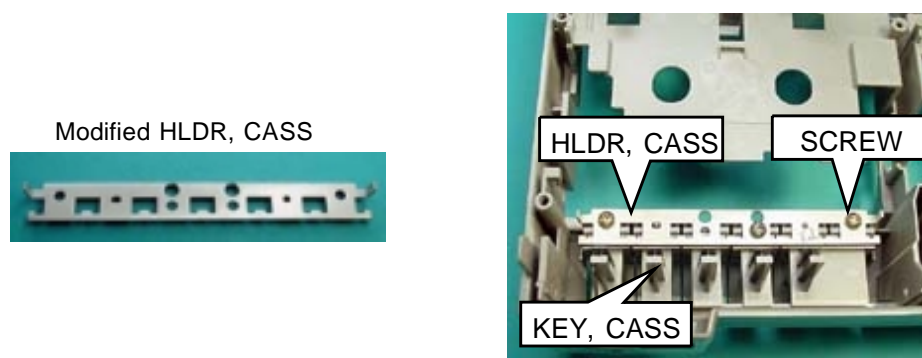

| Ref. | Parts Code | Description | Remarks |
|------|----------------|-------------|---------|
| – | 8A-NFA-232-010 | HLDR, CASS | – |

| G | R | Code No. | Access Code | Modified Ser. No. | Parts Schedule |
|---|---|----------|-------------|-------------------|----------------|
| – | – | – | – | – | – |